


MFB알루미늄합금 허브

MFBS올스테인레스제

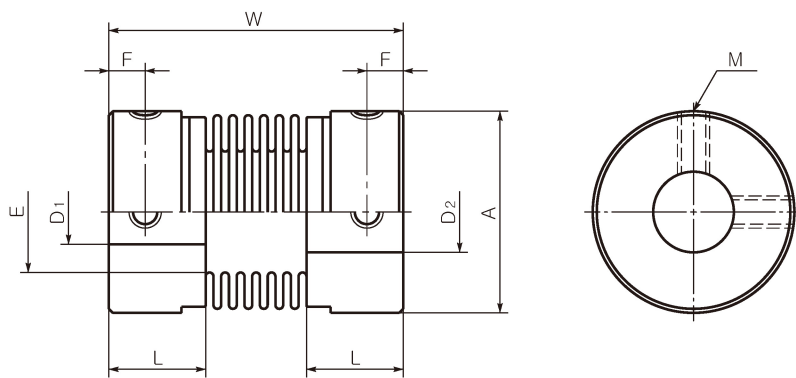



|규격

단위 : mm

품번 1	A	L	W	E	F	G	M	나사체결토크 (N·m)	표준축구멍지름 D1×D2 2							
									3	4	5	6	8	10	12	14
MFB-12	12	7.5	23.5	7	2.5	-	M2.5	0.5	●	●	●	●				
MFB-16	16	9	26.5	9.5	3	-	M3	0.7		●	●	●	●			
MFB-20	20	10	33	12.5	3.5	-	M3	0.7			●	●	●	●		
MFB-25	25	12	36.5	15	4.5	-	M4	1.7				●	●	●	●	
MFB-32	32	13.5	42	21	5.5	-	M4	1.7				●	●	●	●	●
MFBS-12	12	7.5	23.5	7	2.5	-	M2.5	0.5	●	●	●	●				
MFBS-16	16	9	26.5	9.5	3	-	M3	0.7		●	●	●	●			
MFBS-20	20	10	32	12.5	3.5	-	M3	0.7			●	●	●	●		
MFBS-25	25	12	36.5	15	4.5	-	M4	1.7				●	●	●	●	
MFBS-32	32	13.5	42	21	5.5	-	M4	1.7				●	●	●	●	●
MFB-12C	12	7.5	23.5	7	2.25	4	M2	0.5		●	●					
MFB-16C	16	9	26.5	9.5	3	5	M2.5	1			●	●				
MFB-20C	20	10	33	12.5	3.5	6.5	M2.5	1				●	●			
MFB-25C	25	12	36.5	15	4.5	9	M3	1.5					●	●		
MFB-32C	32	13.5	42	21	5	11	M4	2.5					●	●	●	●
MFBS-12C	12	7.5	23.5	7	2.25	4	M2	0.5		●	●					
MFBS-16C	16	9	26.5	9.5	3	5	M2.5	1			●	●				
MFBS-20C	20	10	32	12.5	3.5	6.5	M2.5	1				●	●			
MFBS-25C	25	12	36.5	15	4.5	9	M3	1.5					●	●		
MFBS-32C	32	13.5	42	21	5	11	M4	2.5					●	●	●	●

- 전상품에 육각렌치무두볼트(**MFB** **MFBS**) 또는 육각렌치볼트(**MFB-C** **MFBS-C**)가 포함되어 있습니다.
- 축구경이 $\phi 4$ 이하는 멈춤나사가 1개입니다.
- 세트스크류타입의 축구멍지름의 치수 허용오차는 H8입니다.
- 적용축지름의 추천 허용차는 h6 및 h7입니다.
- 클램핑형 **MFB-C** **MFBS-C** 를 D컷축에 장착할 경우, 축의 D컷면 위치에 주의 바랍니다.

MFB-C 알루미늄합금 허브
MFBS-C 올스테인레스제

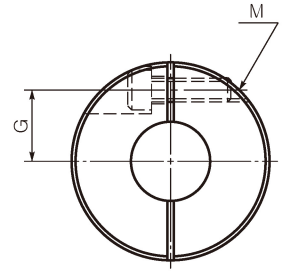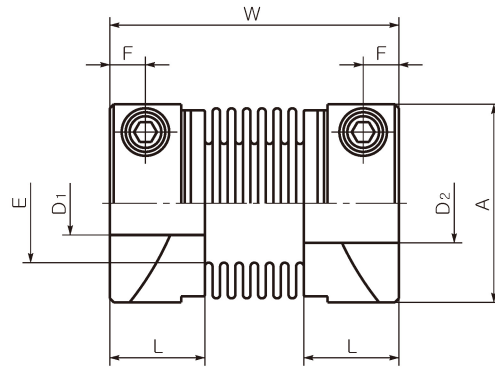

| 성능

품번	최대축구멍지름 (mm)	상용토크* (N·m)	최대토크* (N·m)	최고회전수 (min ⁻¹)	관성모멘트** (kg·m ²)	정적비틀림정수 (N·m/rad)	허용편심 (mm)	허용편각 (°)	허용엔드플레이 (mm)	질량** (g)
MFB-12	6.35	0.3	0.6	52000	9.0×10^{-8}	82	0.1	1.5	$+0.4$ -1.2	4.1
MFB-16	8	0.5	1	39000	3.5×10^{-7}	110	0.1	1.5	$+0.4$ -1.2	9
MFB-20	10	0.8	1.6	31000	9.9×10^{-7}	180	0.15	2	$+0.6$ -1.8	16
MFB-25	12	1.3	2.6	25000	3.1×10^{-6}	240	0.15	2	$+0.6$ -1.8	32
MFB-32	16	2	4	19000	9.2×10^{-6}	330	0.2	2	$+0.8$ -2.5	57
MFBS-12	6.35	0.5	1	52000	2.1×10^{-7}	100	0.1	1.5	$+0.4$ -1.2	9.1
MFBS-16	8	1	2	39000	8.0×10^{-7}	150	0.1	1.5	$+0.4$ -1.2	20
MFBS-20	10	1.5	3	31000	2.3×10^{-6}	220	0.15	2	$+0.6$ -1.8	37
MFBS-25	12	2	4	25000	7.0×10^{-6}	330	0.15	2	$+0.6$ -1.8	73
MFBS-32	16	3	6	19000	2.1×10^{-5}	490	0.2	2	$+0.8$ -2.5	130
MFB-12C	5	0.3	0.6	52000	9.7×10^{-8}	82	0.1	1.5	$+0.4$ -1.2	3.8
MFB-16C	6.35	0.5	1	39000	3.7×10^{-7}	110	0.1	1.5	$+0.4$ -1.2	9.8
MFB-20C	8	0.8	1.6	31000	1.0×10^{-6}	180	0.15	2	$+0.6$ -1.8	16
MFB-25C	10	1.3	2.6	25000	3.1×10^{-6}	240	0.15	2	$+0.6$ -1.8	32
MFB-32C	14	2	4	19000	9.6×10^{-6}	330	0.2	2	$+0.8$ -2.5	58
MFBS-12C	5	0.5	1	52000	2.1×10^{-7}	100	0.1	1.5	$+0.4$ -1.2	9.2
MFBS-16C	6.35	1	2	39000	8.1×10^{-7}	150	0.1	1.5	$+0.4$ -1.2	22
MFBS-20C	8	1.5	3	31000	2.3×10^{-6}	220	0.15	2	$+0.6$ -1.8	38
MFBS-25C	10	2	4	25000	6.9×10^{-6}	330	0.15	2	$+0.6$ -1.8	74
MFBS-32C	14	3	6	19000	2.1×10^{-5}	490	0.2	2	$+0.8$ -2.5	130

*부하변동에 의한 상용토크·최대토크의 보정은 필요 없습니다.

**최대 축 구멍지름에서의 값입니다.

• 품번지정

MFB-12C-4×5

◀1

▶2